

Theme: Oxydated fuse

Theme area Electrical Telephone +49 (0)40/ 739 606 – 42

Version 02/2010 Date: 11.02.2010

Photo 1



Battery cable / tail-lift fuse is not secured enough against splashing water

In order to avoid failure, we suggest following steps:

Loosen the battery plus clamp, remove the copper bridge
Cut the red cable (16 mm²) about 100 mm behind the cable socket

Remove about 10-15 mm of the cable protection at its end

Squeeze the cable socket open
Screw on the fuse

Position the shrink hose in the middle over the fuse
Shrink the hose with a hot air pistol
Screw the cable socket directly onto the battery clamp

More technical information and news can be found under
www.soerensen.de

Photo 2:

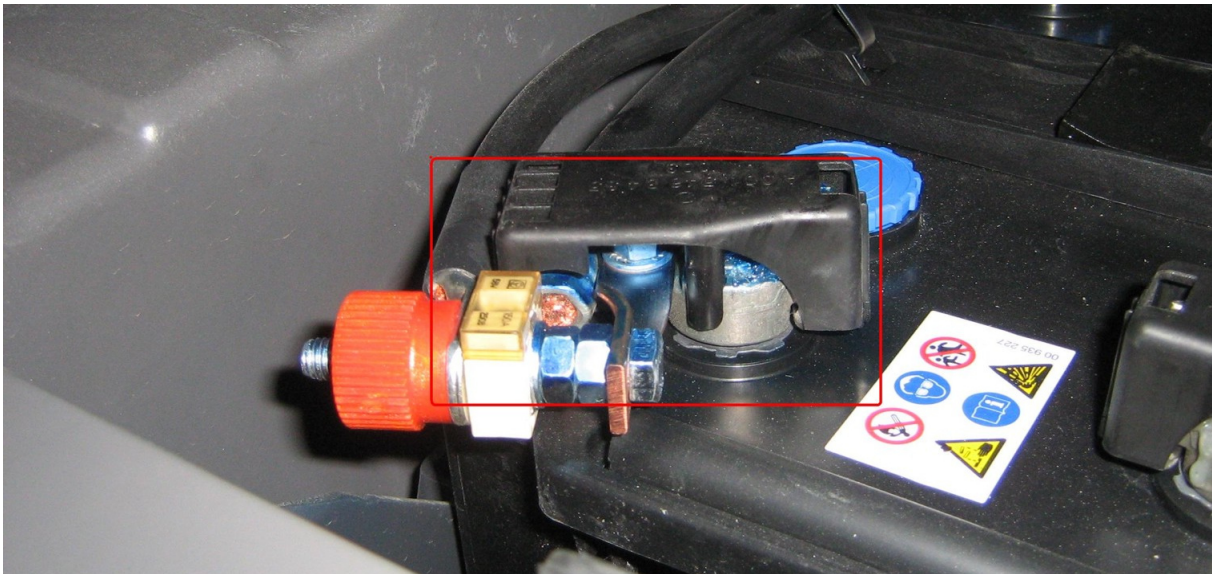


Photo 3:



Package content:
part Nr. : 22 908 474
fuse 150 A

More technical information and news can be found under
www.soerensen.de